

Notice



- ☐ CORRECTION
 ☒ PRODUCTION CHANGE
☐ SERVICE FLASH
 ☐ ADD INFORMATION

FILE NO.

REVISION 4

Please add this notice to the Service Manual listed below.

Category: COLOR TELEVISION	Date: May / 15 / 2007
Model: DP19647	Effective from : Chassis No. P19647-04
Destination: U.S.A. / CANADA	REF. No. SM780139

NOTE: Match the Chassis No. on the unit's back cover with the Chassis No. in the Service Manual. **If the Service Manual Chassis No. does not match the unit's**, additional Service Literature is required. This chassis is similar to Chassis No. P19647-00. Only the **difference** Service Information is given in this manual. For detailed Service Information, refer to the **Original** Service Manual and **Notices** for Chassis No. P19647-00 used in Model DP19647 (SM780139).

Servicing should be performed by only trained and qualified service personnel.

1. IN THE CHASSIS ELECTRICAL PARTS LIST MAIN PC BOARD AND MISCELLANEOUS

The reason for change.


- A : Misprint B : Quality Reliability C : Standardization
 D : Design E : Add as a possible sub F : Schematic location change
 G : Purchasing Request

Page & Section	Schematic Location		Part No.	Description	Q'ty	Interchangeability	Reason
Page 21 Chassis Electrical Parts List	R1263	Old	RGFR000ZTCANL	MT-GLAZE 0.000 JA 1/10W	1	NO	D
		New	RGF1001JTCANL	MT-GLAZE 1K JA !/10W	1	NO	
	R1266	Old	RGF2201JTCANL	MT-GLAZE 2.2K JA 1/10W	1	NO	D
		New	RGF1001JTCANL	MT-GLAZE 1K JA !/10W	1	NO	
	R1269	Old	RGFR000ZTCANL	MT-GLAZE 0.000 JA 1/10W	1	NO	D
		New	RGF1001JTCANL	MT-GLAZE 1K JA !/10W	1	NO	
	R1271	Old	RGF2201JTCANL	MT-GLAZE 2.2K JA 1/10W	1	NO	D
		New	RGF1001JTCANL	MT-GLAZE 1K JA !/10W	1	NO	

2. IN THE SCHEMATIC DIAGRAMS AND PARTS LIST

Add the following parts to the main pc board schematic diagram and parts list.

IC6270
Stereo A/D Converter
QXXAVC859P

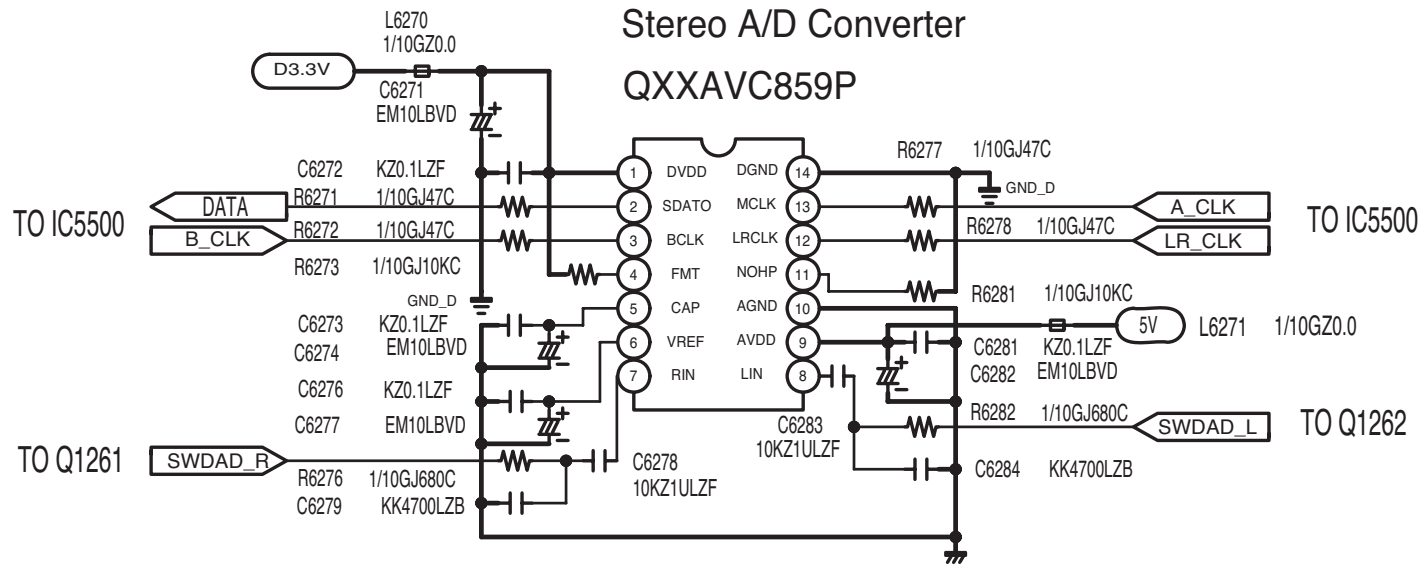

Schematic Location	Part No.	Description
--------------------	----------	-------------

Schematic Location	Part No.	Description
--------------------	----------	-------------

CAPACITORS

C6271	CEXLB1H100VDN	ELECT	10U M	50V
	CEXLB1H100WAN	ELECT	10U M	50V
C6272	CK1H104ZLZFNG	CERAMIC	0.1U Z	50V
C6273	CK1H104ZLZFNG	CERAMIC	0.1U Z	50V
C6274	CEXLB1H100VDN	ELECT	10U M	50V
	CEXLB1H100WAN	ELECT	10U M	50V
C6276	CK1H104ZLZFNG	CERAMIC	0.1U Z	50V
C6277	CEXLB1H100VDN	ELECT	10U M	50V
	CEXLB1H100WAN	ELECT	10U M	50V
C6278	CK1A105ZLZFNG	CERAMIC	1U Z	10V
C6279	CK1H472KLZBNG	CERAMIC	4700P K	50V
C6281	CK1H104ZLZFNG	CERAMIC	0.1U Z	50V
C6282	CEXLB1H100VDN	ELECT	10U M	50V
	CEXLB1H100WAN	ELECT	10U M	50V
C6283	CK1A105ZLZFNG	CERAMIC	1U Z	10V
C6284	CK1H472KLZBNG	CERAMIC	4700P K	50V

INTEGRATED CIRCUITS

IC6270	QXXAVC859---P	IC WM8738GED/RV
--------	---------------	-----------------

COILS

L6270	RGFR000ZTAANL	MT-GLAZE	0.000 ZA	1/10W
L6271	RGFR000ZTAANL	MT-GLAZE	0.000 ZA	1/10W

RESISTORS

R6271	RGF47R0JTCANL	MT-GLAZE	47 JA	1/10W
R6272	RGF47R0JTCANL	MT-GLAZE	47 JA	1/10W
R6273	RGF1002JTCANL	MT-GLAZE	10K JA	1/10W
R6276	RGF6800JTCANL	MT-GLAZE	680 JA	1/10W
R6277	RGF47R0JTCANL	MT-GLAZE	47 JA	1/10W
R6278	RGF47R0JTCANL	MT-GLAZE	47 JA	1/10W
R6281	RGF1002JTCANL	MT-GLAZE	10K JA	1/10W
R6282	RGF6800JTCANL	MT-GLAZE	680 JA	1/10W

For parts or service contact

Sanyo Manufacturing Corporation
P.O. Box 2000
3333 Sanyo Road
Forrest City, Arkansas 72335-2000